

1st FINAL INSPECTION REPORT				No.:			
Client/Destination: Inspection Date:	20.July.2014		Supplier: Manufacturer:				
Manuf'r Address:	Longguang Town,Shenzhen City,China		Manuf'r Tel/Fax:				
Product Description:	Bluetooth speaker		Order Qty.:		20000pcs		
Model No:	SK-S10		Inspected Qty:		2000pcs		
Colour:	Black /Blue/ Red						
MIL-STD-105E, Level <u>II</u> , S/S:Maj: <u>315</u> pcs,Min: <u>315</u> pcs		AQL	Allowed	Found	Result		ılt
		Critical:0.00	0	0	Passed		
3/3.iviaj. <u>313</u> pcs,iviini. <u>3</u>	<u>10 pcs</u>	Major:1.5	10	0	Rejected		
		Minor:4.0	<b>21</b>	3	Pending	X	REMARK 1

Defects Description	Cri	Maj	Min
Gap on the product due to lossen screw.		3	
Total:	0	3	0

## Remarks:

## 1. Inspection found issue:

- A—During inspection, factory only provide 2000pcs black product for inspection.
- B—DURING INSPECTION NO DEVICES WAS AVAILABLE FOR SENSITIVITY AND FREQUENCY RESPONSE TEST.
- C— The shipping mark should use English not Chinese (黑 should be black on shipping mark)
- D— Actual packing 50pcs per CTN instead 100pcs per CTN on spec.
- E—THE "Fiashing Instruction" WAS SHOWN ON PAGE 3 OF INSTRUCTION SHEET, ACTUAL IT SHOULD BE "Flashing instruction"
- F—ACTUAL PRODUCT HAVE RADIO (FM) FUNCTION BUT NO ANY INFORMATION SHOWN ON GIFT BOX OR INSTRUCTION SHEET OR PRODUCT MENTION THE PRODUCT HAVE THIS FUNCTION.
- G— THE DESCRIPTION SHOWN ON INSTRUCTION CAN NOT MATCH ACTUAL PRODUCT'S FINDING, DETAILS REFER TO BELOW

	IT SHOWN ON ACTUAL INSTRUCTION	FOR ACTUAL PRODUCT FINDING		
	MANUAL			
1.	ON PAGE 1 OF I/M: IN TF /BLUETOOTH	IN AUX MODE WHEN LONG		
	MODE WHEN LONG PRESS THE +/>> /	PRESS THE +/M / +/M		
	: VOLUME UP / DOWN, DON'T	: VOLUME UP / DOWN		
	WORK IN AUX MODE.	TOO.		
2.	ON PAGE 1 OF I/M: DOUBLE CLICK THE	DOUBLE CLICK THE IN		
	IN BLUETOOTH MODE: LAST	BLUETOOTH MODE: PLAY OR		
	NUMBER REDIAL	PAUSE THE BLUETHOOTH		
		FUNCTION.		
3.	ON PAGE 1 OF I/M: IN BLUETOOTH	ACTUAL WAS WHEN PRODUCT		
	MODE LONG PRESS ► FOR 2	IN STANDBY MODE LONG PRESS		
	SECONDS: REJECT CALLS	→ FOR 2 SECONDS : LAST		
		NUMBER REDIAL; WHEN		
		PRODUCT IN INCOMING CALL		
		LONG PRESS <sup>▶</sup> FOR 2		
		SECONDS: REJECT CALLS		
4.	ON PAGE 2 OF I/M: IN BLUETOOTH	ACTUAL WAS BLUE LED WILL		
	PAIRING MODE: PRESS ON/OFF KEY TO	STATIC ON ABOUT 5 SECONDS		
		THEN BLUE AND GREEN LED		



	BLUE TOOTH MODE, BLUE LED WILL	FLASH ALTERNATELY
	FLASH 6 TIMES.	CONTINUITY.
5.	ON PAGE 2 OF I/M: IN BLUETOOTH	ACTUAL WAS IN BLUETOOTH
	PAIRING MODE: PRESS ON/OFF KEY TO	PAIRING MODE: PRESS ON/OFF
	BLUE TOOTH MODE THEN SHORT PRESS	KEY TO BLUE TOOTH MODE
	PLAY/PAUSE KEY: BLUE AND RED LED	THEN SHORT PRESS PLAY/PAUSE
	FLASH ALTERNATELY	KEY: PRODUCT NO RESPONSE
6.	ON PAGE 3 OF I/M: FLASHING	ACTUAL WAS WHEN TF CARD
	INSTRUCTION: WHEN TF CARD MP3 IN	MP3 OR AUX IN PAUSE MODE:
	PAUSE OR IN AUX MODE: GREEN LED	GREEN LED ON.
	ON.	
7.	ON PAGE 3 OF I/M: FLASHING	ACTUAL WAS WHEN GREEN AND
	INSTRUCTION: WHEN RED AND BLUE	BLUE LED FLASH ALTERNATELY:
	LED FLASH ALTERNATELY: BLUETOOTH	BLUETOOTH PAIRING
	PAIRING	

H— Factory refused drop test.

I— Function test was conducted for all sample and the result was pass.

## 2. Marking & Label:

Rating label was stuck on bottom of product.

3. Size and weight testing:

	Size: L * W *	' H (cm)	Weight (Kg)			
Item	On the outer carton/gift box shows	Testing result	On the outer carton/gift box shows	Testing result		
Outer carton	33x 33 x22	33x33x20	27.6	14.3		
Gift box	/	6.2x6.2x7.5	/	0.27		
Product	/	¢5.9x5.0 (H)	/	0.26		


<sup>4.</sup>packing: 1pcs specker was packed into a color box with instruction sheet and USB line; then 50pcs box into a master carton. Total 50pcs product per sack.

Christina Jiang, Luther Lou & Andy Yao (Inspectors)

## 4. Photo





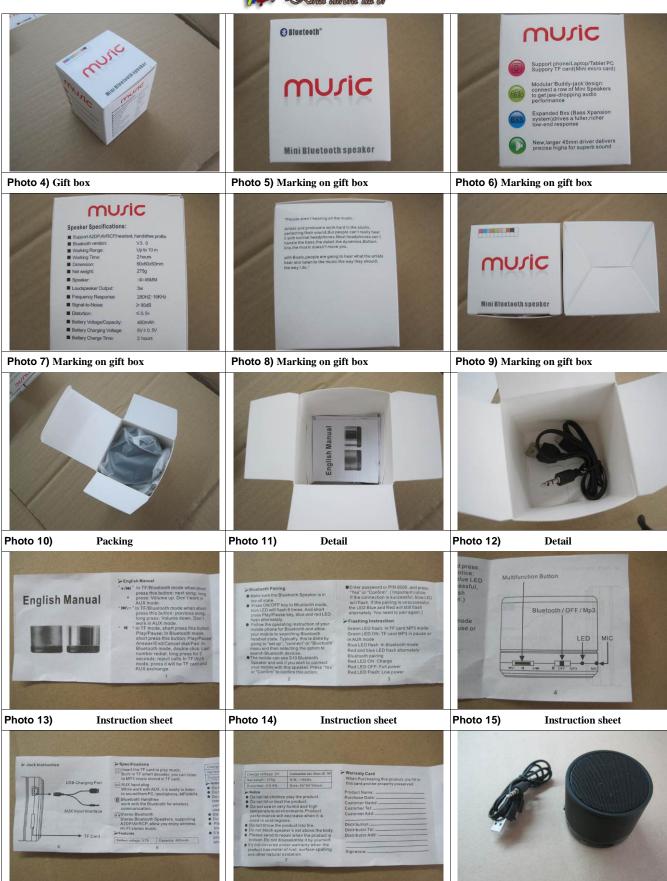

**Instruction sheet** 

Photo 18)

Product

Photo 17)

Photo 16)

**Instruction sheet** 









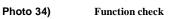




Photo 35) Gap on the product due to lossen screw.



Photo 36) Remark -C 黑 should be black